



Time of Transfer Inspection Report (DNR Form 542-0191)

Property information

Current Owner Mrs Royer
Buyer
Mailing Address 10564 Rolling Hills Dr Burlington Iowa
Site Address/County 10564 Rolling Hills Dr Burlington Iowa

No. of Bedrooms 3 Last Occupied? No Disposal? Y/N Softener? Y/N H2O Supply? City
Records Available yes Permit/Installation Date 12-12-1978 Installer ?

Septic System Information

Septic Tank(s): Size 1000-600 Material concrete Condition 60% est
Tank Pumped? yes Date 6-28-2020 Licensed Pumper st-09
Septic/Trash/Processing Tank: Size na Material na Condition na
Tank pumped? no Date na Licensed Pumper no

Aerobic treatment unit (ATU) MFGR no Size na
Tank Pumped? no Date na Licensed Pumper no
Maintenance Contract? no Expiration Date na Service Provider na
Condition na

Pump Tanks/Vaults: Type na Size na Condition na

Distribution System: Distribution Box na Outlets Used na Condition na
Header Pipe(s) na Number of Lines na
Pressure Dosed? no

Secondary Treatment

Length of Absorption Fields none Determined by inspection
Condition of Fields none Determined by inspection
Type of Trench Material none

Size of Sand Filter 720 sq ft Determined by report
Vent Pipes Above Grade? no Discharge Pipe Located? Yes?
Effluent Sample Taken? no Results none

Media Filters: Type none
Maintenance Contract? no Expiration Date none Service Provider none
Condition na

NPDES General Permit No. 4: Required? no Permitted? yes NOI submitted no



Time of Transfer Inspection Worksheet

Other Components

Alarms no Working? no Disinfection no Working? no

Control Box no Timers no Inspection Ports no

Other Components none

Overall condition of the private sewage disposal system

Acceptable? Yes? Unacceptable? _____

Explain (attach additional pages as needed): On narrative report

Comments: System is working at the time of inspection!!

Site status at conclusion of Time of Transfer inspection:

- Verify that controls are set on the appropriate mode.
- Power is on to all components.
- Revisit all components to verify lids are secure.
- Gather all tools for removal from the site.
- Verify that no sewage is on the ground surface.

Using this worksheet, write a narrative report of the inspection results.

Submit a copy of this report, including your narrative, to the city/county environmental health office, the DNR and the county Recorder in the county where the inspection was conducted.

This report indicates the condition of the private sewage disposal system at the time of the inspection. It does not guarantee that it will continue to function satisfactorily.

Signature of Certified Inspector: _____ Date: 6-26-2020
 Name (print): Glen Meyers Certificate #: 8926
 Address: P.O. Box 488 Keokuk Iowa 52632
 Phone # 319 - 524- 7329

CART H-3 ODOM 127 BE 1092
TWP Town SEC 19
OTHER Herbert Hills sub
Lot #6

Des Moines County Health Unit
522 North Third Street
Burlington, Iowa

Permit No. C-127-77

PRIVATE SEWAGE DISPOSAL SYSTEM PERMIT

Pursuant to the provisions of County Rules and Regulations Governing the Construction, Use and Operation of Private Sewage Disposal Systems, Including Septic Tanks and Sanitary Privies, a permit is hereby issued to Mr. Larry LaMurray Sands 1525 Mt Pleasant St Burlington Lot #6 - Herbert Hills sub - Broeg add 1 to *(Construct) (Reconstruct) (Alter) ^{etc} a 1000 gallon septic tank 720 Bft sub-surface Filter (2 ft thick - other size not known) - No distance given from

This permit is non-transferable, and expires six months from date of issuance house if the installation is not completed within that period. to tanks & filter bed.

This permit must be signed by an Official of the Des Moines County Health Unit upon final inspection approval.

Date Oct 13 - 1977

By [Signature]
Title [Blank]

IMPORTANT! CALL 752-4561 FOR FINAL INSPECTION BEFORE COVERING SYSTEM.

Final inspection approval by the Des Moines County Health Unit:

Date: Dec 12 - 1977

[Signature] [Signature]
Signature Title


See our sketch also plat

* probably 1000 gallons, could be 800 gallons
4806 D-4806-77

CART 4-3 ODOM 127 BE 1092

TWSP _____ SEC _____

OTHER _____

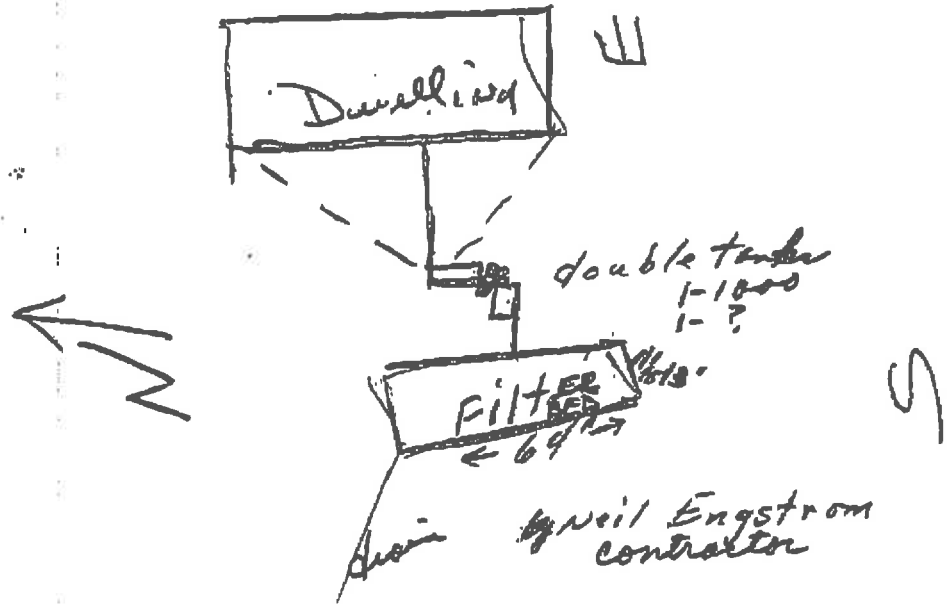

3

Subject: Report
From: Glen Meyers <glrivesetank@qwestoffice.net>
Date: 6/27/2020, 9:59 AM
To: Glen Meyers <glrivesetank@qwestoffice.net>

6-27-2020

Meyers Septic Service

P.O. Box 488

Keokuk Iowa 52632

Septic Report: 10564 Rolling Hills Dr Burlington Iowa - Mrs Royer

After doing an inspection at this property these are my findings:

Septic System was installed in 1977. It was a permitted system at that time under Des Moines county guidelines. After digging up tanks we noticed the system had been repaired in the past. Which is normal for the age of the system. Tanks are deteriorating. We ran water into sand filter from second tank but could never get water to come out. Which has happened before on other inspections. As of now this system is working but you have to realize the age of this system is over 40 years. So in the near future you could expect repairs or replacement!!

Thank You

Owner

1-319-524-7329